	Equipment :	Fixture								Loss Type : Defect Loss KAIZEN IDEA S										IEET	
	Department :	QA								Result: N P		Q	С	D	S	М					
Distinctly Akead	Cell :	Fabrication		Туре :			Ka					Kaizer	aizen ID : 2869								
Unit Name : 11086											obotic										
Kaizen Theme: To elir	ninate Customer comp	K Idea :																			
Problem / Present Status			Counter Measure								Benchmark : 15										
Grab Handle tapping hard at Customer end			2 mm SIM added to increase Ladder pipe LH RH CD to match profile						ofile		Target :				0	0					
												Start : 12		12/06/2	12/06/2016		Finish	Finished : 15/06/20		16	
										111	Note :				<u> </u>						
										4	Team Members :										
										1	1. Ajit Singh				2. Nak	2. Nakul					
									and the second second			3. Amit Singh				4. Bat	4. Babita				
													5.				6.	6.			
0									Benefits												
		n	E.F.	O	1	G	3	STACK .													
Why Why Analysis :				Result :								Kaizen Sustenance :									
W1 : Why Grab handle tapping not ok. ?			Customer Complaint Eliminated								What To Do :										
A1 : Bush tilt in opposite direction and bush to bush center distance increase.																					
W2 : Why Bush tilt in opposite direction and bush to bush center distance increase. ?			120									How To Do :									
 A2 : Hammering done for profile matching of LH RH rear top pipe and BKt grab handle W3 : Why Hammering done for profile matching of LH RH rear top pipe and BKt grab handle ? A3 : Seat rail pipe pipe to pipe CD spect.188mm found 184mm and gap up to 4mm gap observed in fixture. W4 : Why Seat rail pipe pipe to pipe CD spect.188mm found 184mm and gap up to 4mm gap observed in fixture. ? A4 : 			100 - 96 98 80 - 60 - 58 Kaizen Implimentat 47																		
												Frequency :									
									lion			Cost Inc	curred	For Ma	king K	aizen	:				
			40 -					Material Cost					Labour Cost			Total					
			20 -										0.00			0		00 0.00)	
							0 0 6 Jun-16 Jul-16			Scope & Plan For Horizontal Deploy				oyment :	ment :						
Root Cause			Jan-16 Feb-16 Mar-16 Apr-16 May-16 Jun-16 Jul-16							101-10		Equip			uipmne	inet		Та	get	Status	
Seat rail pipe pipe to pipe CD spect.188mm found 184mm and gap up to 4mm gap observed in fixture.																					
Date : 15/06/	2016																				
Registered By : Mr. Aji	t Singh																				
Manager's Sign : MR A																					
Bajaj Auto Ltd. (Fabrication)																				