S PA IA I	Equipment :	: Cluster					Loss Type : Defect Loss KAIZEN IDE								EET	
104 2 21 22 2	Department :	Quality				Result : N		P Q	С	D	S	Μ	1			
Distinctly Ahead	Cell :	BM 100 robotic		т	Гуре :									aizen ID : 504		
Unit Name : 10012	1 - LUMAX AUTO TEC	CHNOLOGIES LIMITED, AU	urangabad Operation : Cluster weldi g													
Kaizen Theme: To elir	ninate customer comp	laint - Air filter fitment no	not possible Idea : Location with orientation													
Problem / Present Status			Counter Measure					Benchmark : 15				15				
Air filter fitment not possible -Model BM100/150 Frame assembly			One point locating block replaced by two poin location and other for orientation)	ing block -(One pin for			Target : 0				0					
								Start : 10/		10/06/2	10/06/2013		Finished :	15/06/2013	3	
									:							
								Team Members :								
NOP							1. Mr A	I. Mr Amit Gour				2. Mr. May	2. Mr. Mayur Bhagate			
							3. Mr. Rahul Kumavat			4. Mr. Rros	4. Mr. Rrosaheb Bansode					
							5.					6.	6.			
								Benefits								
Why Why Analysis :			Result :					Kaizen Sustenance :								
W1 : Why Air filter fitment n			Customer compliant trend for Air Filter Fitment Not Possible						What To Do : Check pin wear our, bend , damage							
A1 : Air filter rear top bracket position varies in X and Z direction by 2 to 3 mm																
W2 : Why Air filter rear top bracket position varies in X and Z direction by 2			20						How To Do : Check in PM,							
to 3 mm ? A2 : Only location and No o	rientation to air filter b	racket top	18 Before After 16 15 14						Pin bend -Check with Add on gauge							
W3 : Why Only location and No orientation to air filter bracket top ?			12 10 8					Freque	Frequency : JH- Daily ,PM- Weekly							
A3 :			6 4 2 0													
W4 :			Jun'13 Jul'13					Cost Incurred For Making Kaizen :								
A4 :								Ν	<i>l</i> aterial	Cost		La	abour Cost	Total		
									1000.	00			200.00	1200.00	0	
								Scope	Scope & Plan For Horizontal Deployment :							
Root Cause									Equipmnet Target				Target	Status		
Only location and No orientation to air filter bracket top																
	2042															
Date :10/06/Registered By :Mr. Sa																
Registered By : Mr. Sachin Lahe   Manager's Sign : Mr. Hemant Sriwastava																
Bajaj Auto Ltd. (Fabrication)																